

SERVICE BULLETIN		
To: ALL DEALERS For the attention of: The Service Manager Please copy to: Aston Martin Technician(s) The Dealer Principal The Parts Manager	Reference: SB: 0153 Issued: December 2004	
Model: DB9		
Subject: Reprogramming Modules Following Battery Disconnect		Page 1 of 1

This Service Bulletin is being issued to advise Dealers of necessary system re-programming that must be carried out if the Vehicle Battery has been disconnected or replaced on any DB9 model.

Procedure: -

- Re-programme both front seat modules:
This is carried out with the ignition on and by moving the seat all the way forwards and all the way up, at both front and rear height adjustments check all seat operations are functioning correctly
- Re-programme both front window modules,
This is carried out with the ignition on, and by moving the windows all the way down until the motor is stalled, (a small click will be heard), then moved all the way up until the motor is stalled again. Check all window operations are functioning correctly
- Carry out the Spanish Oak and Transmission adaptive learning process as described in Service Bulletin 0148

If you have any queries in connection with any aspect of this Service Bulletin, please contact Aston Martin Technical Services on +44 (0) 1926 644700/2/3 or facsimile: +44 (0) 1926 644733. or e-mail stiltma1@astonmartin.com, dhende17@astonmartin.com, or nhunter3@astonmartin.com

Thank you for your co-operation in this matter.

We Are Driven By Quality

